



Data ONTAP 5.2 Read Me First

Last Minute Information

Firmware 2.1_a1 required

Data ONTAP™ 5.2 requires that firmware revision 2.1_a1 be installed on the F630 filer.

The firmware is available

- on the CD-ROM--read the intro.txt file to locate the firmware file
- on the [NetApp® On the Web \(NOW\)](#) site.

Corrections to the firmware upgrade procedures

Two procedures in the Software and Firmware Upgrade Guide contain incorrect information.

The procedure titled "Creating the Firmware Upgrade Diskette," which starts, has incorrect information in Step 4. Step 4 should read:

Step	Action
4	Copy the firmware file to the diskette by entering the <code>dd</code> command, as follows: <pre>dd if=firmware.x.x of=/dev/fd0 bs=36b conv=sync</pre> where <code>firmware.x.x</code> is the specific firmware release, <code>of=/dev/fd0</code> is your system's diskette drive, and <code>bs=36b</code> is the blocking factor.

The procedure in the section titled "On an F630," has incorrect information in Step 1. Step 1 should read:

Step	Action	
1	If the system is running...	If the system is not running...
	1. Enter the <code>halt</code> command to shut it down. Result: The <code>ok</code> prompt appears. 2. Power off the system. 3. Power on the system. 4. As it reboots, press Ctrl-C while the memory test is in progress to interrupt the boot process. Result: The <code>ok</code> prompt appears.	Power on the system. As it reboots, press Ctrl-C while the memory test is in progress to interrupt the boot process. Result: The <code>ok</code> prompt appears.



Copyright © 1998, Network Appliance, Inc. All rights reserved.

rmf.htm Last updated: 10/04/98 14:05:35

Part No. 210-02175 A0
October 1998